
## I-5 Lewis and Cowitz counties Milepost 51.09 to Milepost 85.29

## I-5 Lewis and Cowlitz counties

Length: **34.20 miles**Median width: **15-40 feet**Speed limit: **60-70 mph**Year installed: **1997 or before\*** 

## Average annual daily traffic volume

Vehicles per day by year

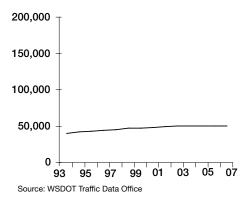

ADT average growth rate on segment is 2 percent per year.





I-5 Lewis/Cowlitz Counties	No injury	Possible injury	Evident injury	Serious injury	Fatality
All median collisions before			No data		
All median collisions after (60 months)	235	102	63	7	4
Cross median collisions before			No data		
Cross median collisions after (60 months)	6	6	2	1	0

<sup>\*</sup> Barrier was installed in several contracts

The concrete median barrier through this area generally is located in the center of the median.

Fifteen cross-median incidents have occurred in this section during the 5 years studied:

- Eight collisions involved vehicles that crossed the median and hit other vehicles traveling in the opposite direction.
- Six of the collisions occurred between mileposts 82.65 and 84.27 an area that includes the Harrison Avenue interchange in Centralia.
- Eleven of the collisions involved southbound vehicles traveling across the median.

Four fatal median-related crashes occurred in this section during the 5 years studied:

- None of these collisions involved vehicles that crossed over the median.
- All of these collisions involved the concrete barrier; in one collision the vehicle rolled over after impact with the concrete barrier. In another, the driver was ejected.



72 - Cable Median Barrier WSDOT/WSP